


**MK10 DEPOSITOR  
V4 DEPOSIT & TRAY CONTROLLER AND V5 DEPOSIT  
SPEED CONTROLLER ADJUSTMENTS AND CONNECTIONS**

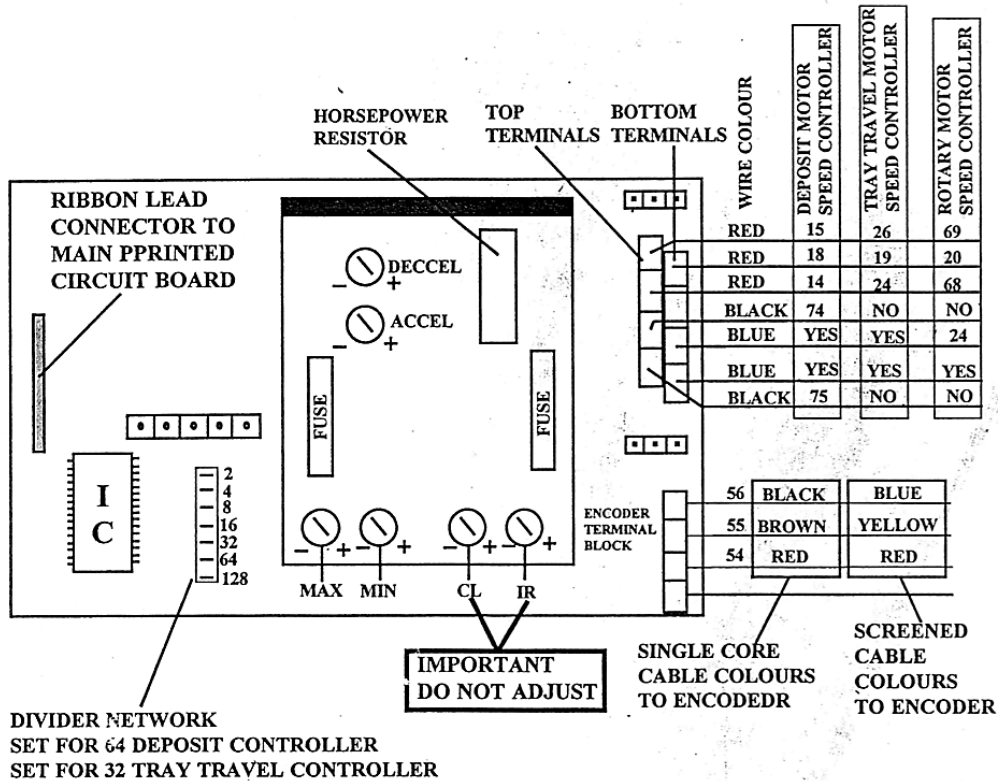

- A) Set appropriate speed setting display to "00", then adjust "MIN" potentiometer to indicate a motor minimum speed setting, clockwise to increase speed, and anticlockwise to decrease speed.  
Adjust so that minimum speed off Deposit or Tray drive shafts are just rotating slowly. To set by armature voltage set for Deposit voltage across terminals 16 & 17 and for tray travel motor across terminals 25 & 27 on main control panel terminal block for approximately 12.5-16 v dc. Armature voltage.
- B) Set appropriate speed setting display to "99", then adjust "MAX" potentiometer to indicate a motor maximum speed setting, clockwise to increase speed, and anticlockwise to decrease speed. For Deposit motor or Tray travel motor set for 1700-1750 rpm or armature voltage off approximately 154v dc.
- C) Then repeat steps A) and B) again until desired minimum and maximum speed settings are achieved.